#### Digital coating thickness gauges SAUTER TF · TG



SAUTER TF

SAUTER TG

# Premium coating thickness gauge for paint coating, lacquer coating etc.

#### Features

- II LCD display, backlit, display of all information at a glance
- Offset-Accur: This function allows you to adjust the instrument precisely on the locally measured range by a two-point calibration. This results in a superior accuracy of approx.
   1 % of the measured value
- Scan mode for continuous measurement or single point measuring mode
- Mini Statistics Kit: displays the measured result, the average value and the max and the min value
- Internal memory up to 99 values
- Selectable measuring units:  $\mu\text{m}\text{,}$  mil
- Base plate and calibration foils included
- Data interface RS-232 standard
- Delivered in a robust carrying case, figure shows SAUTER TF

#### SAUTER TG:

 External sensor for difficult-to-access measuring points

## Technical data

- Measuring precision:
  Standard: 3 % of measured value or ± 2,5 μm
  Offset-Accur: 1 % of measured value or ± 1 μm
- Minimum thickness of base material: 300 µm
- Dimensions W×D×H 65×35×126 mm
- Battery operation, batteries standard 2× 1.5 V AAA
- Net weight approx. 81 g

#### Accessories

Data transfer software, interface cable included, SAUTER ATC-01

SAUTER

- Calibration foils for increased measuring accuracy (covers the range from 20 up to 2000  $\mu m,$  with < 3 % tolerance), SAUTER ATB-US07
- SAUTER TG: External sensor, TypeFN, SAUTER ATG 01

STANDARD		OPTION	
	Y RS 232 STATISTIC ZERO	BATT 1 DAY	SOFTWARE +4 DAYS

Model	Measuring range	Readout	Test object	Smallest sample surface	Option Factory calibration certificates	
	[Max]	[d]		(radius)		
SAUTER	μm	μm		mm	KERN	
TF 1250-0.1FN	100   1250	0,1   1	Combination instrument: F/N	F: Convex: 1,5 Concave: 25	961-112	
TG 1250-0.1FN	100   1250	0,1   1	Combination instrument: F/N	N: Convex: 3 Concave: 50	961-112	

## **SAUTER CATALOGUE 2021**

#### Pictograms



Adjusting program (CAL): For quick setting of the instrument's accuracy. External adjusting weight required



Calibration block: Standard for adjusting or correcting


the measuring device

#### Peak hold function: PEAK

Capturing a peak value within a measuring process




Scan mode: Continuous capture and display of measurements

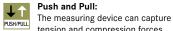

tension and compression forces



Length measurement: Captures the geometric dimensions of a test

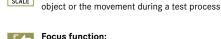

FOCUS

Focus function:

Increases the measuring accuracy of a device within a defined measuring range



Internal memory:

To save measurements in the device memory



## Data interface RS-232:

Bidirectional, for connection of printer and PC



## Profibus:

For transmitting data, e.g. between scales, measuring cells, controllers and peripheral devices over long distances. Suitable for safe, fast, fault-tolerant data transmission. Less susceptible to magnetic interference.



## Profinet:

Enables efficient data exchange between decentralised peripheral devices (balances, measuring cells, measuring instruments etc.) and a control unit (controller). Especially advantageous when exchanging complex measured values, device, diagnostic and process information. Savings potential through shorter commissioning times and device integration possible



#### Data interface USB:


To connect the measuring instrument to a printer, PC or other peripheral devices


## ℅

Bluetooth\* data interface: To transfer data from the balance/measuring

instrument to a printer, PC or other peripherals



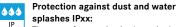

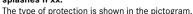




ZERO: Resets the display to "0"

Battery operation:



Ready for battery operation. The battery type is

specified for each device

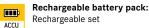

Rechargeable set

230 V



230V/50Hz in standard version for EU. On request GB, AUS or USA version available



Power supply:

Integrated, 230V/50Hz in EU. More standards e.g. GB, AUS or USA on request



Motorised drive: The mechanical movement is carried ELECTRO out by a electric motor



#### Motorised drive:

The mechanical movement is carried out by a synchronous motor (stepper)



Μ

#### Fast-Move:

The total length of travel can be covered by a single lever movement



#### Verification possible:

The time required for verification is specified +3 DAYS in the pictogram



#### DAkkS calibration possible:

The time required for DAkkS calibration is shown in days in the pictogram

### **ISO** +4 DAYS

Factory calibration: The time required for factory calibration is specified in the pictogram



#### Package shipment: The time required for internal shipping

preparations is shown in days in the pictogram

#### Pallet shipment:



The time required for internal shipping preparations is shown in days in the pictogram

\*The Bluetooth® word mark and logos are registered trademarks owned by Bluetooth SIG, Inc. and any use of such marks by KERN & SOHN GmbH is under license. Other trademarks and trade names are those of their respective owners.

Your KERN specialist dealer:



#### It is a standardized interface command set for KERN balances and other instruments, which allows retrieving and controlling all relevant parameters and functions of the device. KERN devices featuring KCP are thus easily integrated with computers, industrial controllers and other digital systems

For connecting the scale/measuring instrument

GLP/ISO record keeping:

Of measurement data with date, time and PRINTER serial number. Only with SAUTER printers

WLAN data interface:

Data interface Infrared:

To connect relays, signal lamps,

To transfer data from the balance/measuring

instrument to a printer, PC or other peripherals

To transfer data from the measuring instrument

to a printer, PC or other peripheral devices

Control outputs (optocoupler, digital I/O):

To connect a suitable peripheral device for

analogue processing of the measurements

For output of an electrical signal depending

Using the saved values, the device

calculates statistical data, such as

To transfer the measurement data

to print out the measurement data

from the device to a PC

Network interface:

to an Ethernet network

average value, standard deviation etc.

A printer can be connected to the device

on the load (e.g. voltage 0 V - 10 V or current

Ì

WIFI

• (((() •

IR

\_0\_0\_

SWITCH

ANALOG

ANALOG

1m

STATISTIC

SOFTWARE

古

LAN

KCP

PROTOCOL

valves, etc.

Analogue interface:

Analog output:

4 mA – 20 mA) Statistics:

PC Software:

Printer:

#### Measuring units:

Weighing units can be switched to e.g. non-metric at the touch of a key. Please refer to website for more details



Measuring with tolerance range

(limit-setting function): Upper and lower limiting can be programmed individually. The process is supported by an audible or visual signal, see the relevant model

S



